

SERVICE POINTER



FOR IMMEDIATE ATTENTION OF YOUR SERVICE DEPARTMENT

- LAUNDRY PRODUCTS REFRIGERATION PRODUCTS KITCHEN PRODUCTS
 COMMERCIAL LAUNDRY

L8178661
May 2007

THIS SERVICE POINTER APPLIES TO THE FOLLOWING BRANDS:



MAYTAG AND WHIRLPOOL BRAVOS AND CABRIO WASHERS

CONTROL DISPLAYS F51 Code

MODEL NUMBERS:

MTW6300T, MTW6500T, MTW6600T, WTW6200S, WTW6300S, WTW6400S, WTW6600S

SERIAL CODE RANGE: PRIOR TO CU13

WARNING



Electrical Shock Hazard

Disconnect power before servicing.

Replace all parts and panels before operating.

Failure to do so can result in death or electrical shock.

CONDITION:

The electronic control displays an F51 code.

CAUSE:

There is an intermittent connection at the Rotor Position Sensor, (RPS), causing the electronic control to indicate an F51 code.

CORRECTION:

Remove and reinstall the connector at the RPS at least three times to clean off any corrosion built up on the connector and RPS due to the intermittent connection. Confirm that the connector is fully seated onto the RPS control upon final connection and verify there are no damaged wires.

Replace the electronic control with part #W10130544. This new control is designed to check the RPS sensor differently and is less sensitive to intermittent RPS connections.

ALL SERVICE POINTERS ONLINE: http://www.servicematters.com/tech_ref/tech_ref_main.htm, SERVICE POINTERS
COMMERCIAL LAUNDRY ONLY: www.whirlpoolcorp.com/cltpsc, TECHNICAL INFORMATION, SERVICE POINTERS
To receive pointers by email or FAX, or to edit or delete a current email or Fax from our distribution, see
http://www.whirlpoolcorp.com/cltpsc/feedback/feedbacksubscribe_all.html, or FAX changes to 269-923-5805.