

SERVICE POINTER



FOR IMMEDIATE ATTENTION OF YOUR SERVICE DEPARTMENT

LAUNDRY PRODUCTS REFRIGERATION PRODUCTS KITCHEN PRODUCTS

COMMERCIAL LAUNDRY

L8178627
January 2007

THIS SERVICE POINTER APPLIES TO THE FOLLOWING BRANDS:



KitchenAid

JENN-AIR

Amana

BY WHIRLPOOL CORPORATION

Admiral

MAYTAG FRONT LOAD WASHER AND STACKED LAUNDRY PRODUCTS

GRINDING NOISE

MODEL NUMBERS

Domestic: CAH4205AW, MAH55FLBW, MAH5500BW, MAH6500AW, MLE2000AY,
MLE2000AZ, MLG2000AW

Commercial: MAH21PDD3W, MAH21PDDGW, MAH21PDDW, MAH21PDDX, MAH21PND,
MAH21PRD, MAH21PSD, MLE19PDDG, MLE19PDDY, MLE19PNDY, MLE19PRDY,
MLG19PDDG, MLG19PDDW, MLG19PNDW, MLG19PRDW

Export: MAH7550AA, MAH7550AG

SERIAL CODE RANGE: ALL

CONDITION:

Grinding noise.

CAUSE:

Motor wiring harness is vibrating against the washer base.

RESOLUTION:

Apply a foam wrap or foam pad between the motor wire harness and the base. See *Figure 1*.

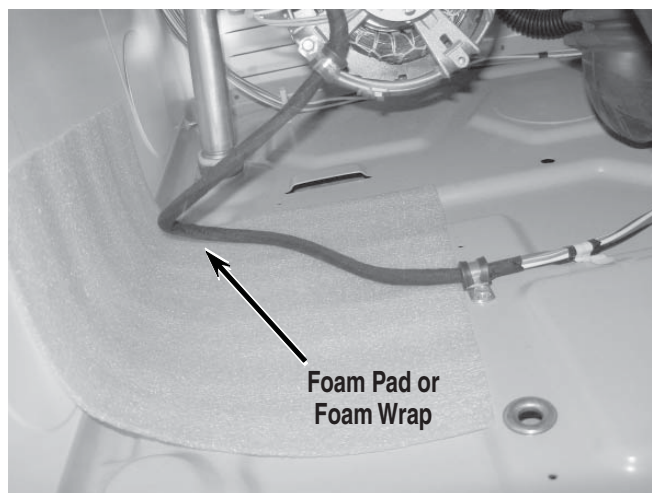


Figure 1

ALL SERVICE POINTERS ONLINE: http://www.servicematters.com/tech_ref/tech_ref_main.htm, SERVICE POINTERS
COMMERCIAL LAUNDRY ONLY: www.whirlpoolcorp.com/cltpsc, TECHNICAL INFORMATION, SERVICE POINTERS
To receive pointers by email or FAX, or to edit or delete a current email or Fax from our distribution, see
http://www.whirlpoolcorp.com/cltpsc/feedback/feedbacksubscribe_all.html, or FAX changes to 269-923-5805.